

Radio, Phonograph and Tape Service Tips

Volume XXI Issue 1 January 30, 1970

Important Information for your Service Department

Prepared and Distributed by RCA Sales Corporation, Product Performance 600 N. Sherman Drive, Indianapolis, Indiana 46201

Service Data

1965 No. 37

1966 No. 17


1967 No. 32

1968 No. 34

RS-225B Amplifier Chassis Layout

The chassis layout wiring view has been modified to show components with dotted outline. CR401 diode polarity has been polarized to agree with schematic.

Care should be exercised in replacing CR401 to insure correct circuit operating potentials.

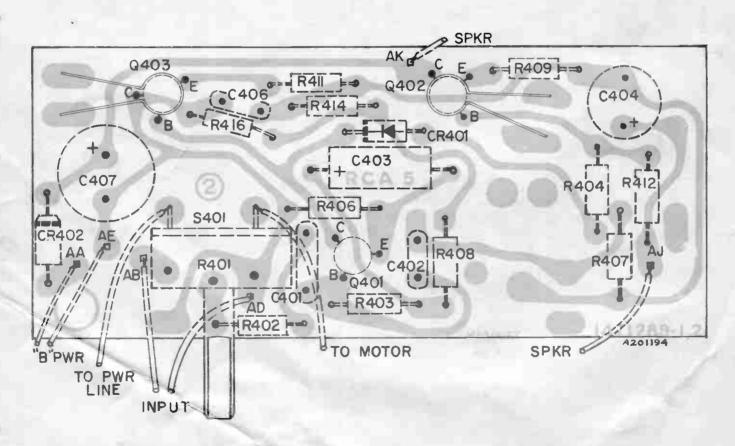

Chassis Layout—Wiring View RS-225B


Service Data 1968 No. 34-S1 1969 No. 9

RS-250A Chassis Layout

The chassis layout wiring view has been modified to show components with dotted outline.

CR401 diode polarity has been polarized to agree with schematic.

Care should be exercised in replacing CR401 to insure correct circuit operating potentials.

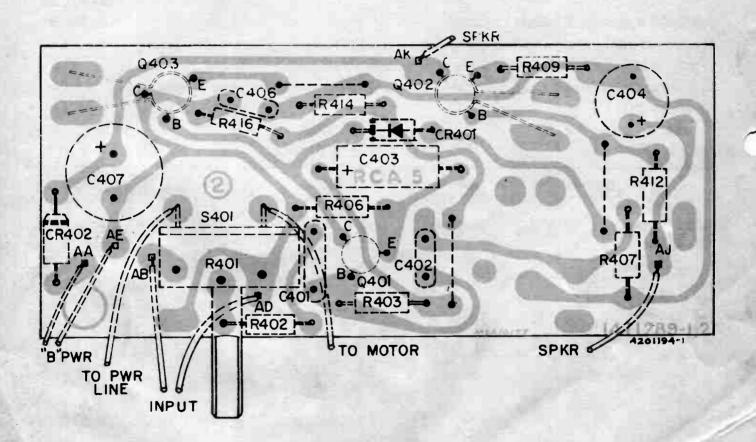

Chassis Layout—Wiring View RS-250A



Radio, Phonograph and Tape Service Tips

Volume XXI Issue 2 November 16, 1970

Important Information for your Service Department


Prepared and Distributed by RCA Sales Corporation, Product Performance 600 N. Sherman Drive, Indianapolis, Indiana 46201

Function Selector RP-230, -231, -232, -233 Service Data 1968 No. 45 1969 No. 35

Erratic or improper function selector operation of these record changers may be resolved by one of the following procedures.

First, if the function selector is forced toward SEL during the last record shut-off cycle the control lever may warp downward causing the switch tab on the control lever to miss the switch assembly. In the event this occurs, and the control lever (Stock No. 126066) is bent, it must be straightened or replaced. Also the switch (Stock No. 108457) may be damaged.

Secondly, operation of certain changers (some early versions utilizing two switches) may be enhanced by the addition of a piece of plastic tubing (spaghetti) over the switch tabs. Each piece of the tubing must be $\frac{3}{6}$ long and fit snugly on the tabs.

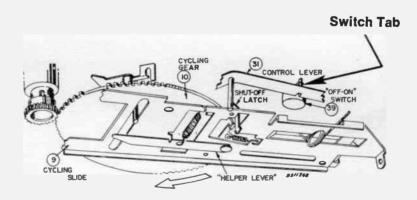

Cycling assembly—RP-230